

B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 21

View of a spherical hail-caused fracture in the glazed terra cotta tile parapet cap.



Photograph 22

View of the spherical hail-caused fractures in the glazed terra cotta tile parapet cap.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 23

View of a spherical hail-caused impact fracture in the bitumen and reinforcement mat on the parapet wall. Note the dark bitumen.



Photograph 24

View of a 23 percent moisture reading taken adjacent to a spherical hail-caused impact mark with fractured bitumen on the roof.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 25

View of the dark bitumen exposure at the spherical impact marks.



Photograph 26

View of the spherical hail-caused impact fractures in the bitumen cover along the base of the penthouse brick wall.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 27

View of the spherical impact fractures in the east-side parapet.



Photograph 28

Close view of a spherical hail-caused impact fracture in the bitumen.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 29

View of a spherical hail-caused fracture in the bitumen approximately 2.0 inches in diameter.



Photograph 30

Close view of a spherical hail-caused impact fracture in the bitumen.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 31

Close view of a spherical hail-caused impact fracture in the bitumen with dark bitumen exposure.



Photograph 32

View of a fractured area on the GB BUR where the roofing flexed under foot pressure.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 33

View of the lower GB BUR with mod-bit curbs and bitumen cover on the parapets.



Photograph 34

View of the lower GB BUR over the hallway and restaurant, the mod-bit roof over the storage area, and the metal panel awning at the south entrance.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 35

View looking north over the 1st story GB BUR along the east side of the building.



Photograph 36

View looking south over the 1st story GB BUR along the east side of the building.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 37

View of the lower 1st story GB BUR.



Photograph 38

View of the spherical hail-caused indentations in the north-facing condenser fins.



**B-HCE Report Number 44-22003 – Pendant Properties, LLC
Attachments**

Photograph 39

View of a shiny spherical hail-caused indentation approximately 1.2 inches in the north-facing condenser fins.



Photograph 40

View of the spherical hail-caused indentations in the rigid ductwork.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 41

View of a spherical hail-caused indentation approximately 0.8 inches in diameter.



Photograph 42

View of the spherical hail-caused indentations in the rigid ductwork.

